

RESERVE STUDIES | INSURANCE APPRAISALS | WIND MITIGATION

SEVILLE CONDO 4 1012 PEARCE DRIVE

Windstorm Mitigation Report

Seville Condominium #4

Clearwater, FL

Prepared Exclusively for Seville Condominium #4, Inc.

As of 05-20-2024 | FPAT File# MUD2422405

Felten Property Assessment Team

866.568.7853 | www.fpat.com



CERTIFICATION OF WINDSTORM MITIGATION AFFIDAVIT(S)

This is to certify the enclosed Windstorm Mitigation Inspection report prepared for Seville Condominium #4, Inc. is the result of work performed by Felten Property Assessment Team and one or more of the individuals listed below.

In addition, we certify that, to the best of our knowledge and belief:

- > All facts contained in this report are true and accurate.
- FPAT has no present or prospective interest in the subject property of this report, and also has no personal interest with respect to the parties involved.
- FPAT has no bias with respect to the subject property of this report or to the parties involved with this assignment.
- Our engagement in this assignment was not contingent upon producing or reporting predetermined results.
- Our compensation is not contingent on any action or event resulting from this report.
- We have the knowledge and experience to generate accurate windstorm mitigation affidavit(s) for insurance purposes on all buildings contained within this report.
- We have performed a physical inspection of the subject risk(s) contained in this report.
- This report meets or exceeds the standards of the Citizens Inspection Outreach Program.

Key Staff:

Brad Felten

John Felten

Sr. Adjuster # E149535 Flood Certification # 06060373 Certified Wind & Hurricane Mitigation Inspector Sr. Adjuster # D075772 Flood Certification # 05030007 Certified Building Contractor # CBC1255984 Certified Wind & Hurricane Mitigation Inspector

lan Wright

Sr. Adjuster # W273704 Certified Wind & Hurricane Mitigation Inspector













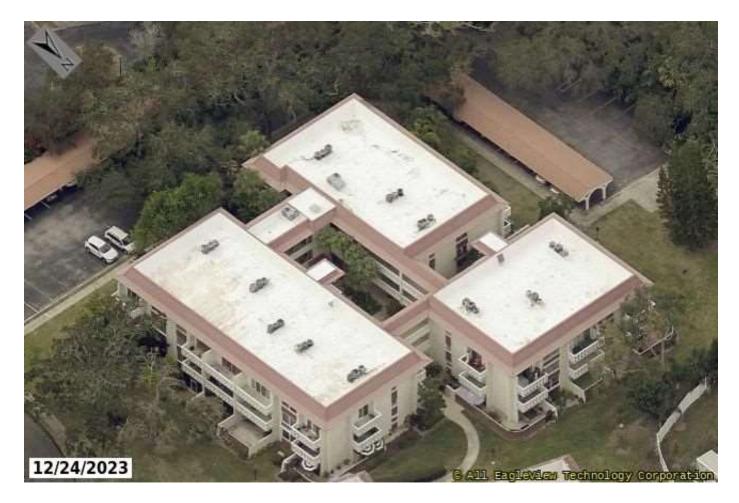



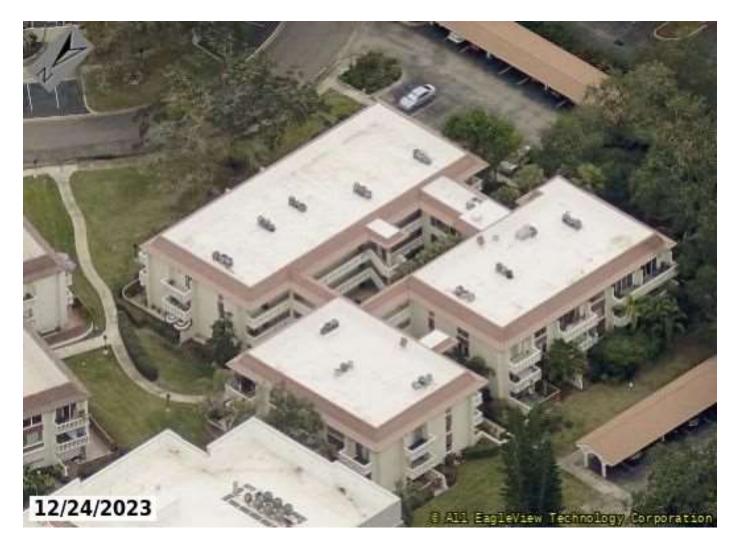



OIR-B1-1802 RECAPITULATION OF BUILDING MITIGATION FEATURES

Seville Condominium #4

Building	Roof Covering	Roof Deck Attachment	Roof-Wall Attachment	Roof Shape	SWR	Opening Protection
1012 Pearce Dr, Building A, Units 107-311	FBC Equivalent	Other	Structural	Flat Roof	No	None or Some Glazed Openings
1012 Pearce Dr, Building B, Units 104-306	FBC Equivalent	Other	Structural	Flat Roof	No	None or Some Glazed Openings
1012 Pearce Dr, Building C, Units 101-303	FBC Equivalent	Other	Structural	Flat Roof	No	None or Some Glazed Openings
1012 Pearce Dr, Elevator Building	FBC Equivalent	Other	Structural	Flat Roof	No	None or Some Glazed Openings





RESERVE STUDIES | INSURANCE APPRAISALS | WIND MITIGATION

Windstorm Mitigation Report (OIR-B1-1802)

Seville Condominium #4, Inc.

1012 Pearce Dr, Building A, Units 107-311

Clearwater, FL 33764

Prepared Exclusively for Seville Condominium #4, Inc.

As of 05-20-2024 | FPAT File# MUD2422405

Felten Property Assessment Team

866.568.7853 | www.fpat.com



RECAPITULATION OF MITIGATION FEATURES For 1012 Pearce Dr, Building A, Units 107-311

1.	Building Code: Comments:	Unknown or does not meet the requirements of Answer A or B The year of construction was verified as 1971 per Pinellas County Property Appraiser.
2.	Roof Covering: Comments:	FBC Equivalent The roof covering was replaced in 2003. The roof permit was confirmed and the permit number is BCP2003-06103. This roof was verified as meeting the building code requirements outlined on the mitigation affidavit. In 2023 a silicone roof coating was applied to the roof to extend the life of the existing roof.
3.	Roof Deck Attachment: Comments:	Other Inspection verified a roof deck composed of lightweight concrete poured in metal pans supported by metal bar joists.
4.	Roof to Wall	Structural
	Attachment: Comments:	Inspection verified a roof-wall connection composed of steel bar joists structurally connected to the wall/support system.
5.	Roof Geometry: Comments:	Flat Roof Inspection verified a flat roof shape.
6.	SWR:	Νο
	Comments:	At the time of inspection, no SWR was verified.
7.	Opening Protection: Comments:	None or Some Glazed Openings Inspection verified some opening protection. Not all glazed openings were protected with impact resistant coverings.

SUPPORTING DOCUMENTION OF WINDSTORM MITIGATION FEATURES LOCATED AT: 1012 Pearce Dr, Building A, Units 107-311

FPAT File #MUD2422405

Address Verification



Exterior Elevation

Exterior Elevation

SUPPORTING DOCUMENTION OF WINDSTORM MITIGATION FEATURES LOCATED AT: 1012 Pearce Dr, Building A, Units 107-311

Exterior Elevation

Roof Permit

Information



Record BCP2003-06103: Building - Over the Counter Permit **Record Status: Completed**

Record Info 🔻 Payments 👻

To see plan review comments: 1. Select Record Info tab above 2. Record Details 3. Select the Print/View Conditions button at the bottom.

To schedule/view inspection 1. Select Record Info tab above 2. Select Inspections

Comments will NOT be available until all plans examiners have completed their revi


Address Info:

1012 PEARCE DR CLEARWATER FL

Record Details

To print a summary of this page click "REPORTS" in the top right hand corner of the page. Then click "CASE SUMMARY" Licensed Professional Info: Project Name SEVILLE CONDO BUILDING 4 REMOVE EXISTING TILE AND UNDERLAYMENT AND INSTALL NEW DRY IN TILE UNDERLAYMENT AND MONIER. SILVERS, MICHAEL J., L/H SILVERS SYSTEMS INC

LIFE TILE

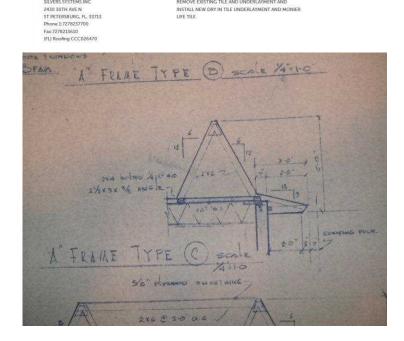

Roof Construction

Felten Property Assessment Team | www.fpat.com

SUPPORTING DOCUMENTION OF WINDSTORM MITIGATION FEATURES LOCATED AT: 1012 Pearce Dr, Building A, Units 107-311

FPAT File #MUD2422405

Roof Construction



Roof Construction

Roof Construction

Roof Construction



Uniform Mitigation Verification Inspection Form

Maintain a copy of this form and any documentation provided with the insurance policy

Inspection Date: 05-20-2024

1		
Owner Information		
Owner Name: Seville Condominium #4, In	Contact Person: Robert Kelly	
Address: 1012 Pearce Dr, Building A, Units 107-311		Home Phone:
City: Clearwater	Zip: 33764	Work Phone: (727) 726-8000
County: Pinellas		Cell Phone:
Insurance Company:		Policy #:
Year of Home: 1971	# of Stories: 3	Email: rkelly@ameritechmail.com

NOTE: Any documentation used in validating the compliance or existence of each construction or mitigation attribute must accompany this form. At least one photograph must accompany this form to validate each attribute marked in questions 3 though 7. The insurer may ask additional questions regarding the mitigated feature(s) verified on this form.

- 1. <u>Building Code</u>: Was the structure built in compliance with the Florida Building Code (FBC 2001 or later) OR for homes located in the HVHZ (Miami-Dade or Broward counties), South Florida Building Code (SFBC-94)?
- [] A. Built in compliance with the FBC: Year Built . For homes built in 2002/2003 provide a permit application with a date after 3/1/2002: Building Permit Application Date (MM/DD/YYYY)
- [] B. For the HVHZ Only: Built in compliance with the SFBC-94: Year Built _____. For homes built in 1994, 1995, and 1996 provide a permit application with a date after 9/1/1994: Building Permit Application Date (MM/DD/YYYY) ___/ __/
- [X] C. Unknown or does not meet the requirements of Answer "A" or "B"
- <u>Roof Covering:</u> Select all roof covering types in use. Provide the permit application date OR FBC/MDC Product Approval number OR Year of Original Installation/Replacement OR indicate that no information was available to verify compliance for each roof covering identified.

2.1 Roof Covering Type:	Permit Application Date	FBC or MDC Product Approval #	Year of Original Installation or Replacement	No Information Provided for Compliance
[] 1. Asphalt/Fiberglass Shingle				[]
[X] 2. Concrete/Clay Tile	06-04-2003		2003	[]
[] 3. Metal				[]
[X] 4. Built Up	06-04-2003		2003	[]
[] 5. Membrane				[]
[X] 6. Other Silicone Coating			2023	[]

- [X] A. All roof coverings listed above meet the FBC with a FBC or Miami-Dade Product Approval listing current at time of installation OR have a roofing permit application date on or after 3/1/02 OR the roof is original and built in 2004 or later.
- [] B. All roof coverings have a Miami-Dade Product Approval listing current at time of installation OR (for the HVHZ only) a roofing permit application after 9/1/1994 and before 3/1/2002 OR the roof is original and built in 1997 or later.
- [] C. One or more roof coverings do not meet the requirements of Answer "A" or "B".
- D. No roof coverings meet the requirements of Answer "A" or "B".

3. **<u>Roof Deck Attachment</u>**: What is the <u>weakest</u> form of roof deck attachment?

- [] A. Plywood/Oriented strand board (OSB) roof sheathing attached to the roof truss/rafter (spaced a maximum of 24" inches o.c.) by staples or 6d nails spaced at 6" along the edge and 12" in the field. -OR- Batten decking supporting wood shakes or wood shingles.
 -OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that has an equivalent mean uplift less than that required for Options B or C below.
- [] B. Plywood/OSB roof sheathing with a minimum thickness of 7/16"inch attached to the roof truss/rafter (spaced a maximum of 24"inches o.c.) by 8d common nails spaced a maximum of 12" inches in the field.-OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent or greater resistance than 8d nails spaced a maximum of 12 inches in the field or has a mean uplift resistance of at least 103 psf.
- [] C. Plywood/OSB roof sheathing with a minimum thickness of 7/16"inch attached to the roof truss/rafter (spaced a maximum of 24"inches o.c.) by 8d common nails spaced a maximum of 6" inches in the field. -OR- Dimensional lumber/Tongue & Groove decking with a minimum of 2 nails per board (or 1 nail per board if each board is equal to or less than 6 inches in width). -OR-Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent

Inspectors Initials Property Address 1012 Pearce Dr, Building A, Units 107-311, Clearwater

or greater resistance than 8d common nails spaced a maximum of 6 inches in the field or has a mean uplift resistance of at least 182 psf.

- [] D. Reinforced Concrete Roof Deck.
- [X] E. Other: Steel bar joist w/ lightweight concrete
- [] F. Unknown or unidentified.
- [] G. No attic access.
- 4. **<u>Roof to Wall Attachment</u>**: What is the <u>WEAKEST</u> roof to wall connection? (Do not include attachment of hip/valley jacks within 5 feet of the inside or outside corner of the roof in determination of WEAKEST type)
- [] A. Toe Nails

[] Truss/rafter anchored to top plate of wall using nails driven at an angle through the truss/rafter and attached to the top plate of the wall, or

[] Metal connectors that do not meet the minimal conditions or requirements of B, C, or D

Minimal conditions to qualify for categories B, C, or D. All visible metal connectors are:

[]Secured to truss/rafter with a minimum of three (3) nails, and

[]Attached to the wall top plate of the wall framing, or embedded in the bond beam, with less than a ¹/₂" gap from the blocking or truss/rafter **and** blocked no more than 1.5" of the truss/rafter, **and** free of visible severe corrosion.

[] B. Clips

[] Metal connectors that do not wrap over the top of the truss/rafter, or

[] Metal connectors with a minimum of 1 strap that wraps over the top of the truss/rafter and does not meet the nail position requirements of C or D, but is secured with a minimum of 3 nails.

[] C. Single Wraps

Metal connectors consisting of a single strap that wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side and a minimum of 1 nail on the opposing side.

[] D. Double Wraps

[] Metal Connectors consisting of 2 separate straps that are attached to the wall frame, or embedded in the bond beam, on either side of the truss/rafter where each strap wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side, and a minimum of 1 nail on the opposing side, or

[] Metal connectors consisting of a single strap that wraps over the top of the truss/rafter, is secured to the wall on both sides, and is secured to the top plate with a minimum of three nails on each side.

[X] E. Structural Anchor bolts structurally connected or reinforced concrete roof.

[] F. Other:

- [] G. Unknown or unidentified
- [] H. No attic access
- 5. <u>Roof Geometry</u>: What is the roof shape? (Do not consider roofs of porches or carports that are attached only to the fascia or wall of the host structure over unenclosed space in the determination of roof perimeter or roof area for roof geometry classification).
- [] A. Hip Roof Hip roof with no other roof shapes greater than 10% of the total roof system perimeter.
- Total length of non-hip features: ; Total roof system perimeter:
- [X] B. Flat Roof Roof on a building with 5 or more units where at least 90% of the main roof area has a roof slope of less than 2:12. Roof area with slope less than 2:12: sq ft; Total roof area: sq ft
- [] C. Other Roof Any roof that does not qualify as either (A) or (B) above.

6. Secondary Water Resistance (SWR): (standard underlayments or hot-mopped felts do not qualify as an SWR)

- [] A. SWR (also called Sealed Roof Deck) Self-adhering polymer modified-bitumen roofing underlayment applied directly to the sheathing or foam adhesive SWR barrier (not foamed-on insulation) applied as a supplemental means to protect the dwelling from water intrusion in the event of roof covering loss.
- [X] B. No SWR.
- [] C. Unknown or undetermined.

Inspectors Initials Property Address 1012 Pearce Dr, Building A, Units 107-311, Clearwater

Opening Protection: What is the <u>weakest</u> form of wind borne debris protection installed on the structure? First, use the table to determine the weakest form of protection for each category of opening. Second, (a) check one answer below (A, B, C, N, or X) based upon the lowest protection level for ALL Glazed openings and (b) check the protection level for all Non-Glazed openings (.1, .2, or .3) as applicable.

Opening Protection Level Chart Place an "X" in each row to identify all forms of protection in use for each opening type. Check only one answer below (A thru X), based on the weakest form of protection (lowest row) for any of the Glazed openings and indicate the weakest form of protection (lowest row) for Non-Glazed openings.			Glazed Openings				Non-Glazed Openings	
		Windows or Entry Doors	Garage Doors	Skylights	Glass Block	Entry Doors	Garage Doors	
N/A	Not Applicable- there are no openings of this type on the structure		Х	Х	Х		Х	
Α	Verified cyclic pressure & large missile (9-lb for windows doors/4.5 lb for skylights)							
В	Verified cyclic pressure & large missile (4-8 lb for windows doors/2 lb for skylights)							
с	Verified plywood/OSB meeting Table 1609.1.2 of the FBC 2007							
D	Verified Non-Glazed Entry or Garage doors indicating compliance with ASTM E 330, ANSI/DASMA 108, or PA/TAS 202 for wind pressure resistance							
N	Opening Protection products that appear to be A or B but are not verified							
N	Other protective coverings that cannot be identified as A, B, or C							
х	No Windborne Debris Protection	Х				Х		

- [] <u>A. Exterior Openings Cyclic Pressure and 9-lb Large Missile (4.5 lb for skylights only)</u> All Glazed openings are protected at a minimum, with impact resistant coverings or products listed as wind borne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level A in the table above).
 - Miami-Dade County PA 201, 202, and 203
 - Florida Building Code Testing Application Standard (TAS) 201, 202, and 203
 - American Society for Testing and Materials (ASTM) E 1886 and ASTM E 1996
 - Southern Standards Technical Document (SSTD) 12
 - For Skylights Only: ASTM E 1886 and ASTM E 1996
 - For Garage Doors Only: ANSI/DASMA 115
 - [] A.1 All Non-Glazed openings classified as A in the table above, or no Non-Glazed openings exist
 - A.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level B, C, N, or X in the table above
 - [] A.3 One or More Non-Glazed Openings is classified as Level B, C, N, or X in the table above
- [] <u>B. Exterior Opening Protection- Cyclic Pressure and 4 to 8-lb Large Missile (2-4.5 lb for skylights only)</u> All Glazed openings are protected, at a minimum, with impact resistant coverings or products listed as windborne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level B in the table above):
 - ASTM E 1886 <u>and</u> ASTM E 1996 (Large Missile 4.5 lb.)
 - SSTD 12 (Large Missile 4 lb. to 8 lb.)
 - For Skylights Only: ASTM E 1886 and ASTM E 1996 (Large Missile 2 to 4.5 lb.)
 - 🗌 B.1 All Non-Glazed openings classified as A or B in the table above, or no Non-Glazed openings exist
 - B.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level C, N, or X in the table above
 - \square B.3 One or More Non-Glazed openings is classified as Level C, N, or X in the table above
- [] <u>C. Exterior Opening Protection- Wood Structural Panels meeting FBC 2007</u> All Glazed openings are covered with plywood/OSB meeting the requirements of Table 1609.1.2 of the FBC 2007 (Level C in the table above).
 - 🗌 C.1 All Non-Glazed openings classified as A, B, or C in the table above, or no Non-Glazed openings exist
 - C.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level N or X in the table above
 - \Box C.3 One or More Non-Glazed openings is classified as Level N or X in the table above

Inspectors Initials Property Address 1012 Pearce Dr, Building A, Units 107-311, Clearwater

[] N. Exterior Opening Protection (unverified shutter systems with no documentation) All Glazed openings are protected with

- protective coverings not meeting the requirements of Answer "A", "B", or C" or systems that appear to meet Answer "A" or "B" with no documentation of compliance (Level N in the table above).
- N.1 All Non-Glazed openings classified as Level A, B, C, or N in the table above, or no Non-Glazed openings exist \square
- N.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level X in the table above
- N.3 One or More Non-Glazed openings is classified as Level X in the table above

[X] X. None or Some Glazed Openings One or more Glazed openings classified and Level X in the table above.

MITIGATION INSPECTIONS MUST BE CERTIFIED BY A OUALIFIED INSPECTOR. Section 627.711(2), Florida Statutes, provides a listing of individuals who may sign this form.

	01		
Qualified Inspector Name: John Felten	License Type: CBC		License or Certificate #: CBC1255984
Inspection Company: Felten Property Assessment Team		Phone:	866-568-7853

Qualified Inspector – I hold an active license as a: (check one)

- Home inspector licensed under Section 468.8314, Florida Statutes who has completed the statutory number of hours of hurricane mitigation training approved by the Construction Industry Licensing Board and completion of a proficiency exam.
- Building code inspector certified under Section 468.607, Florida Statutes.
- \boxtimes General, building or residential contractor licensed under Section 489.111, Florida Statutes.
- Professional engineer licensed under Section 471.015, Florida Statutes.
- Professional architect licensed under Section 481.213, Florida Statutes.
- Any other individual or entity recognized by the insurer as possessing the necessary qualifications to properly complete a uniform mitigation verification form pursuant to Section 627.711(2), Florida Statutes.

Individuals other than licensed contractors licensed under Section 489.111, Florida Statutes, or professional engineer licensed under Section 471.015, Florida Statues, must inspect the structures personally and not through employees or other persons. Licensees under s.471.015 or s.489.111 may authorize a direct employee who possesses the requisite skill, knowledge, and experience to conduct a mitigation verification inspection.

_____ am a qualified inspector and I personally performed the inspection or (licensed Ι, _ John Felten contractors and professional engineers only) I had my employee (Joshua Pierson) perform the inspection and I agree to be responsible for his/her work.

Oualified Inspector Signature:

Date: 05-20-2024

An individual or entity who knowingly or through gross negligence provides a false or fraudulent mitigation verification form is subject to investigation by the Florida Division of Insurance Fraud and may be subject to administrative action by the appropriate licensing agency or to criminal prosecution. (Section 627.711(4)-(7), Florida Statutes) The Qualified Inspector who certifies this form shall be directly liable for the misconduct of employees as if the authorized mitigation inspector personally performed the inspection.

Homeowner to complete: I certify that the named Qualified Inspector or his or her employee did perform an inspection of the residence identified on this form and that proof of identification was provided to me or my Authorized Representative.

Signature:

Date:

An individual or entity who knowingly provides or utters a false or fraudulent mitigation verification form with the intent to obtain or receive a discount on an insurance premium to which the individual or entity is not entitled commits a misdemeanor of the first degree. (Section 627.711(7), Florida Statutes)

The definitions on this form are for inspection purposes only and cannot be used to certify any product or construction feature as offering protection from hurricanes.

Inspectors Initials Froperty Address 1012 Pearce Dr, Building A, Units 107-311, Clearwater



RESERVE STUDIES | INSURANCE APPRAISALS | WIND MITIGATION

Windstorm Mitigation Report (OIR-B1-1802)

Seville Condominium #4, Inc.

1012 Pearce Dr, Building B, Units 104-306

Clearwater, FL 33764

Prepared Exclusively for Seville Condominium #4, Inc.

As of 05-20-2024 | FPAT File# MUD2422405

Felten Property Assessment Team

866.568.7853 | www.fpat.com



RECAPITULATION OF MITIGATION FEATURES For 1012 Pearce Dr, Building B, Units 104-306

1.	Building Code: Comments:	Unknown or does not meet the requirements of Answer A or B The year of construction was verified as 1971 per Pinellas County Property Appraiser.
2.	Roof Covering: Comments:	FBC Equivalent The roof covering was replaced in 2003. The roof permit was confirmed and the permit number is BCP2003-06103. This roof was verified as meeting the building code requirements outlined on the mitigation affidavit. In 2023 a silicone roof coating was applied to the roof to extend the life of the existing roof.
3.	Roof Deck Attachment: Comments:	Other Inspection verified a roof deck composed of lightweight concrete poured in metal pans supported by metal bar joists.
4.		Structural
	Attachment: Comments:	Inspection verified a roof-wall connection composed of steel bar joists structurally connected to the wall/support system.
5.	Roof Geometry: Comments:	Flat Roof Inspection verified a flat roof shape.
6.	SWR: Comments:	No At the time of inspection, no SWR was verified.
7.	Opening Protection: Comments:	None or Some Glazed Openings Inspection verified some opening protection. Not all glazed openings

SUPPORTING DOCUMENTION OF WINDSTORM MITIGATION FEATURES LOCATED AT: 1012 Pearce Dr, Building B, Units 104-306



Exterior Elevation



Exterior Elevation

Exterior Elevation

SUPPORTING DOCUMENTION OF WINDSTORM MITIGATION FEATURES LOCATED AT: 1012 Pearce Dr, Building B, Units 104-306



FPAT File #MUD2422405

Exterior Elevation

Exterior Elevation

 Record Info *
 Payments *

 To see plan review comments:
 1. select Record Info tab above

 2. Record Details
 3. Select the Print/View Conditions button at the bottom.

3. Select the Print/View Conditions button at the bot To schedule/view inspections:

1. Select Record Info tab above 2. Select Inspections

Comments will NOT be available until all plans examiners have completed their reviews.

Address Info:

1012 PEARCE DR CLEARWATER FL

Record Details

To print a summary of this page click "REPORTS" in the top right hand corner of the page. Then click "CASE SUMMARY"

Is prime assessment of the second line: SILVERS, MICHAEL J. L/H SILVERS SYSTEMS INC 2430 3011 AVE N ST PETERSBURG, FL 33713 Phone 1:227823700 Fax:227823510 (FL) Roofing CCC026470

Project Name SEVILLE CONDO BUILDING 4 REMOVE EXISTING TILE AND UNDERLAYMENT AND INSTALL NEW DRY IN TILE UNDERLAYMENT AND MONIER LIFE TILE

Roof Permit Information

Felten Property Assessment Team | www.fpat.com

SUPPORTING DOCUMENTION OF WINDSTORM MITIGATION FEATURES LOCATED AT: 1012 Pearce Dr, Building B, Units 104-306

Roof Construction



Roof Construction

Roof Construction

SUPPORTING DOCUMENTION OF WINDSTORM MITIGATION FEATURES LOCATED AT: 1012 Pearce Dr, Building B, Units 104-306



Roof Construction



Roof Construction

Uniform Mitigation Verification Inspection Form

Maintain a copy of this form and any documentation provided with the insurance policy

Inspection Date: 05-20-2024

1		
Owner Information		
Owner Name: Seville Condominium #4, In	Contact Person: Robert Kelly	
Address: 1012 Pearce Dr, Building B, Units 104-306		Home Phone:
City: Clearwater	Zip: 33764	Work Phone: (727) 726-8000
County: Pinellas		Cell Phone:
Insurance Company:		Policy #:
Year of Home: 1971	# of Stories: 3	Email: rkelly@ameritechmail.com

NOTE: Any documentation used in validating the compliance or existence of each construction or mitigation attribute must accompany this form. At least one photograph must accompany this form to validate each attribute marked in questions 3 though 7. The insurer may ask additional questions regarding the mitigated feature(s) verified on this form.

- 1. <u>Building Code</u>: Was the structure built in compliance with the Florida Building Code (FBC 2001 or later) OR for homes located in the HVHZ (Miami-Dade or Broward counties), South Florida Building Code (SFBC-94)?
- [] A. Built in compliance with the FBC: Year Built . For homes built in 2002/2003 provide a permit application with a date after 3/1/2002: Building Permit Application Date (MM/DD/YYYY)
- [] B. For the HVHZ Only: Built in compliance with the SFBC-94: Year Built _____. For homes built in 1994, 1995, and 1996 provide a permit application with a date after 9/1/1994: Building Permit Application Date (MM/DD/YYYY) ___/ ___/
- [X] C. Unknown or does not meet the requirements of Answer "A" or "B"
- <u>Roof Covering:</u> Select all roof covering types in use. Provide the permit application date OR FBC/MDC Product Approval number OR Year of Original Installation/Replacement OR indicate that no information was available to verify compliance for each roof covering identified.

2.1 Roof Covering Type:	Permit Application Date	FBC or MDC Product Approval #	Year of Original Installation or Replacement	No Information Provided for Compliance
[] 1. Asphalt/Fiberglass Shingle				[]
[X] 2. Concrete/Clay Tile	06-04-2003		2003	[]
[] 3. Metal				[]
[X] 4. Built Up	06-04-2003		2003	[]
[] 5. Membrane				[]
[X] 6. Other Silicone Coating			2023	[]

- [X] A. All roof coverings listed above meet the FBC with a FBC or Miami-Dade Product Approval listing current at time of installation OR have a roofing permit application date on or after 3/1/02 OR the roof is original and built in 2004 or later.
- [] B. All roof coverings have a Miami-Dade Product Approval listing current at time of installation OR (for the HVHZ only) a roofing permit application after 9/1/1994 and before 3/1/2002 OR the roof is original and built in 1997 or later.
- [] C. One or more roof coverings do not meet the requirements of Answer "A" or "B".
- D. No roof coverings meet the requirements of Answer "A" or "B".

3. **<u>Roof Deck Attachment</u>**: What is the <u>weakest</u> form of roof deck attachment?

- [] A. Plywood/Oriented strand board (OSB) roof sheathing attached to the roof truss/rafter (spaced a maximum of 24" inches o.c.) by staples or 6d nails spaced at 6" along the edge and 12" in the field. -OR- Batten decking supporting wood shakes or wood shingles.
 -OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that has an equivalent mean uplift less than that required for Options B or C below.
- [] B. Plywood/OSB roof sheathing with a minimum thickness of 7/16"inch attached to the roof truss/rafter (spaced a maximum of 24"inches o.c.) by 8d common nails spaced a maximum of 12" inches in the field.-OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent or greater resistance than 8d nails spaced a maximum of 12 inches in the field or has a mean uplift resistance of at least 103 psf.
- [] C. Plywood/OSB roof sheathing with a minimum thickness of 7/16"inch attached to the roof truss/rafter (spaced a maximum of 24"inches o.c.) by 8d common nails spaced a maximum of 6" inches in the field. -OR- Dimensional lumber/Tongue & Groove decking with a minimum of 2 nails per board (or 1 nail per board if each board is equal to or less than 6 inches in width). -OR-Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent

Inspectors Initials *Property* Address <u>1012 Pearce Dr</u>, Building B, Units 104-306, Clearwater

or greater resistance than 8d common nails spaced a maximum of 6 inches in the field or has a mean uplift resistance of at least 182 psf.

- [] D. Reinforced Concrete Roof Deck.
- [X] E. Other: Steel bar joist w/ lightweight concrete
- [] F. Unknown or unidentified.
- [] G. No attic access.
- 4. **<u>Roof to Wall Attachment</u>**: What is the <u>WEAKEST</u> roof to wall connection? (Do not include attachment of hip/valley jacks within 5 feet of the inside or outside corner of the roof in determination of WEAKEST type)
- [] A. Toe Nails

[] Truss/rafter anchored to top plate of wall using nails driven at an angle through the truss/rafter and attached to the top plate of the wall, or

[] Metal connectors that do not meet the minimal conditions or requirements of B, C, or D

Minimal conditions to qualify for categories B, C, or D. All visible metal connectors are:

[]Secured to truss/rafter with a minimum of three (3) nails, and

[]Attached to the wall top plate of the wall framing, or embedded in the bond beam, with less than a ¹/₂" gap from the blocking or truss/rafter **and** blocked no more than 1.5" of the truss/rafter, **and** free of visible severe corrosion.

[] B. Clips

[] Metal connectors that do not wrap over the top of the truss/rafter, or

[] Metal connectors with a minimum of 1 strap that wraps over the top of the truss/rafter and does not meet the nail position requirements of C or D, but is secured with a minimum of 3 nails.

[] C. Single Wraps

Metal connectors consisting of a single strap that wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side and a minimum of 1 nail on the opposing side.

[] D. Double Wraps

[] Metal Connectors consisting of 2 separate straps that are attached to the wall frame, or embedded in the bond beam, on either side of the truss/rafter where each strap wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side, and a minimum of 1 nail on the opposing side, or

[] Metal connectors consisting of a single strap that wraps over the top of the truss/rafter, is secured to the wall on both sides, and is secured to the top plate with a minimum of three nails on each side.

[X] E. Structural Anchor bolts structurally connected or reinforced concrete roof.

[] F. Other:

- [] G. Unknown or unidentified
- [] H. No attic access
- 5. <u>Roof Geometry</u>: What is the roof shape? (Do not consider roofs of porches or carports that are attached only to the fascia or wall of the host structure over unenclosed space in the determination of roof perimeter or roof area for roof geometry classification).
- [] A. Hip Roof Hip roof with no other roof shapes greater than 10% of the total roof system perimeter.
- Total length of non-hip features: ; Total roof system perimeter:
- [X] B. Flat Roof Roof on a building with 5 or more units where at least 90% of the main roof area has a roof slope of less than 2:12. Roof area with slope less than 2:12: sq ft; Total roof area: sq ft
- [] C. Other Roof Any roof that does not qualify as either (A) or (B) above.

6. Secondary Water Resistance (SWR): (standard underlayments or hot-mopped felts do not qualify as an SWR)

- [] A. SWR (also called Sealed Roof Deck) Self-adhering polymer modified-bitumen roofing underlayment applied directly to the sheathing or foam adhesive SWR barrier (not foamed-on insulation) applied as a supplemental means to protect the dwelling from water intrusion in the event of roof covering loss.
- [X] B. No SWR.
- [] C. Unknown or undetermined.

Inspectors Initials Property Address 1012 Pearce Dr, Building B, Units 104-306, Clearwater

Opening Protection: What is the <u>weakest</u> form of wind borne debris protection installed on the structure? First, use the table to determine the weakest form of protection for each category of opening. Second, (a) check one answer below (A, B, C, N, or X) based upon the lowest protection level for ALL Glazed openings and (b) check the protection level for all Non-Glazed openings (.1, .2, or .3) as applicable.

Opening Protection Level Chart Place an "X" in each row to identify all forms of protection in use for each opening type. Check only one answer below (A thru X), based on the weakest form of protection (lowest row) for any of the Glazed openings and indicate the weakest form of protection (lowest row) for Non-Glazed openings.			Glazed Openings				Non-Glazed Openings	
		Windows or Entry Doors	Garage Doors	Skylights	Glass Block	Entry Doors	Garage Doors	
N/A	Not Applicable- there are no openings of this type on the structure		Х	Х	Х		Х	
Α	Verified cyclic pressure & large missile (9-lb for windows doors/4.5 lb for skylights)							
В	Verified cyclic pressure & large missile (4-8 lb for windows doors/2 lb for skylights)							
С	Verified plywood/OSB meeting Table 1609.1.2 of the FBC 2007							
D	Verified Non-Glazed Entry or Garage doors indicating compliance with ASTM E 330, ANSI/DASMA 108, or PA/TAS 202 for wind pressure resistance							
	Opening Protection products that appear to be A or B but are not verified							
N	Other protective coverings that cannot be identified as A, B, or C							
х	No Windborne Debris Protection	Х				Х		

- [] <u>A. Exterior Openings Cyclic Pressure and 9-lb Large Missile (4.5 lb for skylights only)</u> All Glazed openings are protected at a minimum, with impact resistant coverings or products listed as wind borne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level A in the table above).
 - Miami-Dade County PA 201, 202, and 203
 - Florida Building Code Testing Application Standard (TAS) 201, 202, and 203
 - American Society for Testing and Materials (ASTM) E 1886 and ASTM E 1996
 - Southern Standards Technical Document (SSTD) 12
 - For Skylights Only: ASTM E 1886 and ASTM E 1996
 - For Garage Doors Only: ANSI/DASMA 115
 - [] A.1 All Non-Glazed openings classified as A in the table above, or no Non-Glazed openings exist
 - A.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level B, C, N, or X in the table above
 - [] A.3 One or More Non-Glazed Openings is classified as Level B, C, N, or X in the table above
- [] <u>B. Exterior Opening Protection- Cyclic Pressure and 4 to 8-lb Large Missile (2-4.5 lb for skylights only)</u> All Glazed openings are protected, at a minimum, with impact resistant coverings or products listed as windborne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level B in the table above):
 - ASTM E 1886 <u>and</u> ASTM E 1996 (Large Missile 4.5 lb.)
 - SSTD 12 (Large Missile 4 lb. to 8 lb.)
 - For Skylights Only: ASTM E 1886 and ASTM E 1996 (Large Missile 2 to 4.5 lb.)
 - 🗌 B.1 All Non-Glazed openings classified as A or B in the table above, or no Non-Glazed openings exist
 - B.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level C, N, or X in the table above
 - \square B.3 One or More Non-Glazed openings is classified as Level C, N, or X in the table above
- [] <u>C. Exterior Opening Protection- Wood Structural Panels meeting FBC 2007</u> All Glazed openings are covered with plywood/OSB meeting the requirements of Table 1609.1.2 of the FBC 2007 (Level C in the table above).
 - 🗌 C.1 All Non-Glazed openings classified as A, B, or C in the table above, or no Non-Glazed openings exist
 - C.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level N or X in the table above
 - \Box C.3 One or More Non-Glazed openings is classified as Level N or X in the table above

Inspectors Initials Property Address 1012 Pearce Dr, Building B, Units 104-306, Clearwater

[] N. Exterior Opening Protection (unverified shutter systems with no documentation) All Glazed openings are protected with

- protective coverings not meeting the requirements of Answer "A", "B", or C" or systems that appear to meet Answer "A" or "B" with no documentation of compliance (Level N in the table above).
- N.1 All Non-Glazed openings classified as Level A, B, C, or N in the table above, or no Non-Glazed openings exist \square
- N.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level X in the table above
- N.3 One or More Non-Glazed openings is classified as Level X in the table above

[X] X. None or Some Glazed Openings One or more Glazed openings classified and Level X in the table above.

MITIGATION INSPECTIONS MUST BE CERTIFIED BY A OUALIFIED INSPECTOR. Section 627.711(2), Florida Statutes, provides a listing of individuals who may sign this form.

	01	•	0 1
Qualified Inspector Name: John Felten	License Type: CBC		License or Certificate #: CBC1255984
Inspection Company: Felten Property Assessment Team		Phone:	866-568-7853

Qualified Inspector – I hold an active license as a: (check one)

- Home inspector licensed under Section 468.8314, Florida Statutes who has completed the statutory number of hours of hurricane mitigation training approved by the Construction Industry Licensing Board and completion of a proficiency exam.
- Building code inspector certified under Section 468.607, Florida Statutes.
- \boxtimes General, building or residential contractor licensed under Section 489.111, Florida Statutes.
- Professional engineer licensed under Section 471.015, Florida Statutes.
- Professional architect licensed under Section 481.213, Florida Statutes.
- Any other individual or entity recognized by the insurer as possessing the necessary qualifications to properly complete a uniform mitigation verification form pursuant to Section 627.711(2), Florida Statutes.

Individuals other than licensed contractors licensed under Section 489.111, Florida Statutes, or professional engineer licensed under Section 471.015, Florida Statues, must inspect the structures personally and not through employees or other persons. Licensees under s.471.015 or s.489.111 may authorize a direct employee who possesses the requisite skill, knowledge, and experience to conduct a mitigation verification inspection.

_____ am a qualified inspector and I personally performed the inspection or (*licensed* Ι, _ John Felten contractors and professional engineers only) I had my employee (Joshua Pierson) perform the inspection and I agree to be responsible for his/her work.

Oualified Inspector Signature:

Date: 05-20-2024

An individual or entity who knowingly or through gross negligence provides a false or fraudulent mitigation verification form is subject to investigation by the Florida Division of Insurance Fraud and may be subject to administrative action by the appropriate licensing agency or to criminal prosecution. (Section 627.711(4)-(7), Florida Statutes) The Qualified Inspector who certifies this form shall be directly liable for the misconduct of employees as if the authorized mitigation inspector personally performed the inspection.

Homeowner to complete: I certify that the named Qualified Inspector or his or her employee did perform an inspection of the residence identified on this form and that proof of identification was provided to me or my Authorized Representative.

Signature:

Date:

An individual or entity who knowingly provides or utters a false or fraudulent mitigation verification form with the intent to obtain or receive a discount on an insurance premium to which the individual or entity is not entitled commits a misdemeanor of the first degree. (Section 627.711(7), Florida Statutes)

The definitions on this form are for inspection purposes only and cannot be used to certify any product or construction feature as offering protection from hurricanes.

Inspectors Initials Property Address 1012 Pearce Dr, Building B, Units 104-306, Clearwater



RESERVE STUDIES | INSURANCE APPRAISALS | WIND MITIGATION

Windstorm Mitigation Report (OIR-B1-1802)

Seville Condominium #4, Inc.

1012 Pearce Dr, Building C, Units 101-303

Clearwater, FL 33764

Prepared Exclusively for Seville Condominium #4, Inc.

As of 05-20-2024 | FPAT File# MUD2422405

Felten Property Assessment Team

866.568.7853 | www.fpat.com



RECAPITULATION OF MITIGATION FEATURES For 1012 Pearce Dr, Building C, Units 101-303

1.	Building Code: Comments:	Unknown or does not meet the requirements of Answer A or B The year of construction was verified as 1971 per Pinellas County Property Appraiser.
2.	Roof Covering: Comments:	FBC Equivalent The roof covering was replaced in 2003. The roof permit was confirmed and the permit number is BCP2003-06103. This roof was verified as meeting the building code requirements outlined on the mitigation affidavit. In 2023 a silicone roof coating was applied to the roof to extend the life of the existing roof.
3.	Roof Deck Attachment: Comments:	Other Inspection verified a roof deck composed of lightweight concrete poured in metal pans supported by metal bar joists.
4.	Roof to Wall	Structural
	Attachment: Comments:	Inspection verified a roof-wall connection composed of steel bar joists structurally connected to the wall/support system.
5.	Roof Geometry: Comments:	Flat Roof Inspection verified a flat roof shape.
6.	SWR:	Νο
	Comments:	At the time of inspection, no SWR was verified.
7.	Opening Protection: Comments:	None or Some Glazed Openings Inspection verified some opening protection. Not all glazed openings were protected with impact resistant coverings.

SUPPORTING DOCUMENTION OF WINDSTORM MITIGATION FEATURES LOCATED AT: 1012 Pearce Dr, Building C, Units 101-303



FPAT File #MUD2422405

Exterior Elevation

Exterior Elevation

Exterior Elevation

SUPPORTING DOCUMENTION OF WINDSTORM MITIGATION FEATURES LOCATED AT: 1012 Pearce Dr, Building C, Units 101-303

FPAT File #MUD2422405

Exterior Elevation



Exterior Elevation

Roof Permit Information

Comments will NOT be available until all plans examiners have completed their reviews.

Address Info:

1012 PEARCE DR CLEARWATER FL

Record Details


To print a summary of this page click "REPORTS" in the top right hand corner of the page. Then click "CASE SUMMARY"

Licensed Professional Info: SILVERS, MICHAEL 3, L/H SILVERS SYSTEMS INC 2430 30TH AVE N ST PFERSBURG, FL 33713 Phone 1:7278237700 Far:727213501 (FL) Roofing CCC026470

Project Name SEVILLE CONDO BUILDING 4 REMOVE EXISTING THLE AND UNDERLAYMENT AND INSTALL NEW DRY IN THE UNDERLAYMENT AND MONIER LIFE THLE

SUPPORTING DOCUMENTION OF WINDSTORM MITIGATION FEATURES LOCATED AT: 1012 Pearce Dr, Building C, Units 101-303

Roof Construction

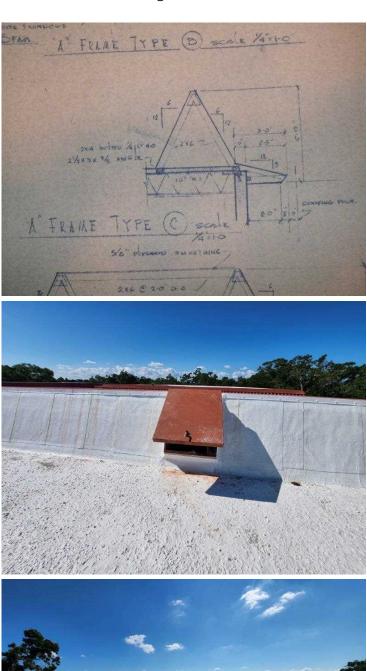

Roof Construction

Roof Construction

SUPPORTING DOCUMENTION OF WINDSTORM MITIGATION FEATURES LOCATED AT: 1012 Pearce Dr, Building C, Units 101-303

FPAT File #MUD2422405



Roof Construction

Roof Construction

Uniform Mitigation Verification Inspection Form

Maintain a copy of this form and any documentation provided with the insurance policy

Inspection Date: 05-20-2024

1						
Owner Information						
Owner Name: Seville Condominium #4, In	Contact Person: Robert Kelly					
Address: 1012 Pearce Dr, Building C, Unit	Home Phone:					
City: Clearwater Zip: 33764		Work Phone: (727) 726-8000				
County: Pinellas		Cell Phone:				
Insurance Company:		Policy #:				
Year of Home: 1971	# of Stories: 3	Email: rkelly@ameritechmail.com				

NOTE: Any documentation used in validating the compliance or existence of each construction or mitigation attribute must accompany this form. At least one photograph must accompany this form to validate each attribute marked in questions 3 though 7. The insurer may ask additional questions regarding the mitigated feature(s) verified on this form.

- 1. <u>Building Code</u>: Was the structure built in compliance with the Florida Building Code (FBC 2001 or later) OR for homes located in the HVHZ (Miami-Dade or Broward counties), South Florida Building Code (SFBC-94)?
- [] A. Built in compliance with the FBC: Year Built . For homes built in 2002/2003 provide a permit application with a date after 3/1/2002: Building Permit Application Date (MM/DD/YYYY)
- [] B. For the HVHZ Only: Built in compliance with the SFBC-94: Year Built _____. For homes built in 1994, 1995, and 1996 provide a permit application with a date after 9/1/1994: Building Permit Application Date (MM/DD/YYYY) ___/ ___/
- [X] C. Unknown or does not meet the requirements of Answer "A" or "B"
- <u>Roof Covering:</u> Select all roof covering types in use. Provide the permit application date OR FBC/MDC Product Approval number OR Year of Original Installation/Replacement OR indicate that no information was available to verify compliance for each roof covering identified.

2.1 Roof Covering Type:	Permit Application Date	FBC or MDC Product Approval #	Year of Original Installation or Replacement	No Information Provided for Compliance
[] 1. Asphalt/Fiberglass Shingle				[]
[X] 2. Concrete/Clay Tile	06-04-2003		2003	[]
[] 3. Metal				[]
[X] 4. Built Up	06-04-2003		2003	[]
[] 5. Membrane				[]
[X] 6. Other Silicone Coating			2023	[]
 [X] 2. Concrete/Clay Tile [] 3. Metal [X] 4. Built Up [] 5. Membrane 			2003	

- [X] A. All roof coverings listed above meet the FBC with a FBC or Miami-Dade Product Approval listing current at time of installation OR have a roofing permit application date on or after 3/1/02 OR the roof is original and built in 2004 or later.
- [] B. All roof coverings have a Miami-Dade Product Approval listing current at time of installation OR (for the HVHZ only) a roofing permit application after 9/1/1994 and before 3/1/2002 OR the roof is original and built in 1997 or later.
- [] C. One or more roof coverings do not meet the requirements of Answer "A" or "B".
- D. No roof coverings meet the requirements of Answer "A" or "B".

3. **<u>Roof Deck Attachment</u>**: What is the <u>weakest</u> form of roof deck attachment?

- [] A. Plywood/Oriented strand board (OSB) roof sheathing attached to the roof truss/rafter (spaced a maximum of 24" inches o.c.) by staples or 6d nails spaced at 6" along the edge and 12" in the field. -OR- Batten decking supporting wood shakes or wood shingles.
 -OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that has an equivalent mean uplift less than that required for Options B or C below.
- [] B. Plywood/OSB roof sheathing with a minimum thickness of 7/16"inch attached to the roof truss/rafter (spaced a maximum of 24"inches o.c.) by 8d common nails spaced a maximum of 12" inches in the field.-OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent or greater resistance than 8d nails spaced a maximum of 12 inches in the field or has a mean uplift resistance of at least 103 psf.
- [] C. Plywood/OSB roof sheathing with a minimum thickness of 7/16"inch attached to the roof truss/rafter (spaced a maximum of 24"inches o.c.) by 8d common nails spaced a maximum of 6" inches in the field. -OR- Dimensional lumber/Tongue & Groove decking with a minimum of 2 nails per board (or 1 nail per board if each board is equal to or less than 6 inches in width). -OR-Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent

Inspectors Initials Property Address 1012 Pearce Dr, Building C, Units 101-303, Clearwater

or greater resistance than 8d common nails spaced a maximum of 6 inches in the field or has a mean uplift resistance of at least 182 psf.

- [] D. Reinforced Concrete Roof Deck.
- [X] E. Other: Steel bar joist w/ lightweight concrete
- [] F. Unknown or unidentified.
- [] G. No attic access.
- 4. **<u>Roof to Wall Attachment</u>**: What is the <u>WEAKEST</u> roof to wall connection? (Do not include attachment of hip/valley jacks within 5 feet of the inside or outside corner of the roof in determination of WEAKEST type)
- [] A. Toe Nails

[] Truss/rafter anchored to top plate of wall using nails driven at an angle through the truss/rafter and attached to the top plate of the wall, or

[] Metal connectors that do not meet the minimal conditions or requirements of B, C, or D

Minimal conditions to qualify for categories B, C, or D. All visible metal connectors are:

[]Secured to truss/rafter with a minimum of three (3) nails, and

[]Attached to the wall top plate of the wall framing, or embedded in the bond beam, with less than a ¹/₂" gap from the blocking or truss/rafter **and** blocked no more than 1.5" of the truss/rafter, **and** free of visible severe corrosion.

[] B. Clips

[] Metal connectors that do not wrap over the top of the truss/rafter, or

[] Metal connectors with a minimum of 1 strap that wraps over the top of the truss/rafter and does not meet the nail position requirements of C or D, but is secured with a minimum of 3 nails.

[] C. Single Wraps

Metal connectors consisting of a single strap that wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side and a minimum of 1 nail on the opposing side.

[] D. Double Wraps

[] Metal Connectors consisting of 2 separate straps that are attached to the wall frame, or embedded in the bond beam, on either side of the truss/rafter where each strap wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side, and a minimum of 1 nail on the opposing side, or

[] Metal connectors consisting of a single strap that wraps over the top of the truss/rafter, is secured to the wall on both sides, and is secured to the top plate with a minimum of three nails on each side.

[X] E. Structural Anchor bolts structurally connected or reinforced concrete roof.

[] F. Other:

- [] G. Unknown or unidentified
- [] H. No attic access
- 5. <u>Roof Geometry</u>: What is the roof shape? (Do not consider roofs of porches or carports that are attached only to the fascia or wall of the host structure over unenclosed space in the determination of roof perimeter or roof area for roof geometry classification).
- [] A. Hip Roof Hip roof with no other roof shapes greater than 10% of the total roof system perimeter.
- Total length of non-hip features: ; Total roof system perimeter:
- [X] B. Flat Roof Roof on a building with 5 or more units where at least 90% of the main roof area has a roof slope of less than 2:12. Roof area with slope less than 2:12: sq ft; Total roof area: sq ft
- [] C. Other Roof Any roof that does not qualify as either (A) or (B) above.

6. Secondary Water Resistance (SWR): (standard underlayments or hot-mopped felts do not qualify as an SWR)

- [] A. SWR (also called Sealed Roof Deck) Self-adhering polymer modified-bitumen roofing underlayment applied directly to the sheathing or foam adhesive SWR barrier (not foamed-on insulation) applied as a supplemental means to protect the dwelling from water intrusion in the event of roof covering loss.
- [X] B. No SWR.
- [] C. Unknown or undetermined.

Inspectors Initials Property Address 1012 Pearce Dr, Building C, Units 101-303, Clearwater

Opening Protection: What is the <u>weakest</u> form of wind borne debris protection installed on the structure? First, use the table to determine the weakest form of protection for each category of opening. Second, (a) check one answer below (A, B, C, N, or X) based upon the lowest protection level for ALL Glazed openings and (b) check the protection level for all Non-Glazed openings (.1, .2, or .3) as applicable.

Opening Protection Level Chart		Glazed Openings				Non-Glazed Openings	
openi form	an "X" in each row to identify all forms of protection in use for each ng type. Check only one answer below (A thru X), based on the weakest of protection (lowest row) for any of the Glazed openings and indicate eakest form of protection (lowest row) for Non-Glazed openings.), based on the weakest openings and indicate Decrements Skylights Decrements Skylights		Glass Block	Entry Doors	Garage Doors	
N/A	Not Applicable- there are no openings of this type on the structure		Х	Х	Х		Х
Α	Verified cyclic pressure & large missile (9-lb for windows doors/4.5 lb for skylights)						
В	Verified cyclic pressure & large missile (4-8 lb for windows doors/2 lb for skylights)						
с	Verified plywood/OSB meeting Table 1609.1.2 of the FBC 2007						
D	Verified Non-Glazed Entry or Garage doors indicating compliance with ASTM E 330, ANSI/DASMA 108, or PA/TAS 202 for wind pressure resistance						
	Opening Protection products that appear to be A or B but are not verified						
N	Other protective coverings that cannot be identified as A, B, or C						
х	No Windborne Debris Protection	Х				Х	

- [] <u>A. Exterior Openings Cyclic Pressure and 9-lb Large Missile (4.5 lb for skylights only)</u> All Glazed openings are protected at a minimum, with impact resistant coverings or products listed as wind borne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level A in the table above).
 - Miami-Dade County PA 201, 202, and 203
 - Florida Building Code Testing Application Standard (TAS) 201, 202, and 203
 - American Society for Testing and Materials (ASTM) E 1886 and ASTM E 1996
 - Southern Standards Technical Document (SSTD) 12
 - For Skylights Only: ASTM E 1886 and ASTM E 1996
 - For Garage Doors Only: ANSI/DASMA 115
 - [] A.1 All Non-Glazed openings classified as A in the table above, or no Non-Glazed openings exist
 - A.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level B, C, N, or X in the table above
 - [] A.3 One or More Non-Glazed Openings is classified as Level B, C, N, or X in the table above
- [] <u>B. Exterior Opening Protection- Cyclic Pressure and 4 to 8-lb Large Missile (2-4.5 lb for skylights only)</u> All Glazed openings are protected, at a minimum, with impact resistant coverings or products listed as windborne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level B in the table above):
 - ASTM E 1886 <u>and</u> ASTM E 1996 (Large Missile 4.5 lb.)
 - SSTD 12 (Large Missile 4 lb. to 8 lb.)
 - For Skylights Only: ASTM E 1886 and ASTM E 1996 (Large Missile 2 to 4.5 lb.)
 - 🗌 B.1 All Non-Glazed openings classified as A or B in the table above, or no Non-Glazed openings exist
 - B.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level C, N, or X in the table above
 - \square B.3 One or More Non-Glazed openings is classified as Level C, N, or X in the table above
- [] <u>C. Exterior Opening Protection- Wood Structural Panels meeting FBC 2007</u> All Glazed openings are covered with plywood/OSB meeting the requirements of Table 1609.1.2 of the FBC 2007 (Level C in the table above).
 - 🗌 C.1 All Non-Glazed openings classified as A, B, or C in the table above, or no Non-Glazed openings exist
 - C.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level N or X in the table above
 - \Box C.3 One or More Non-Glazed openings is classified as Level N or X in the table above

Inspectors Initials Property Address 1012 Pearce Dr, Building C, Units 101-303, Clearwater

[] N. Exterior Opening Protection (unverified shutter systems with no documentation) All Glazed openings are protected with

- protective coverings not meeting the requirements of Answer "A", "B", or C" or systems that appear to meet Answer "A" or "B" with no documentation of compliance (Level N in the table above).
- N.1 All Non-Glazed openings classified as Level A, B, C, or N in the table above, or no Non-Glazed openings exist \square
- N.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level X in the table above
- N.3 One or More Non-Glazed openings is classified as Level X in the table above

[X] X. None or Some Glazed Openings One or more Glazed openings classified and Level X in the table above.

MITIGATION INSPECTIONS MUST BE CERTIFIED BY A OUALIFIED INSPECTOR. Section 627.711(2), Florida Statutes, provides a listing of individuals who may sign this form.

	01		0 1
Qualified Inspector Name: John Felten	License Type: CBC		License or Certificate #: CBC1255984
Inspection Company: Felten Property Assessment Team	l	Phone:	866-568-7853

Qualified Inspector – I hold an active license as a: (check one)

- Home inspector licensed under Section 468.8314, Florida Statutes who has completed the statutory number of hours of hurricane mitigation training approved by the Construction Industry Licensing Board and completion of a proficiency exam.
- Building code inspector certified under Section 468.607, Florida Statutes.
- \boxtimes General, building or residential contractor licensed under Section 489.111, Florida Statutes.
- Professional engineer licensed under Section 471.015, Florida Statutes.
- Professional architect licensed under Section 481.213, Florida Statutes.
- Any other individual or entity recognized by the insurer as possessing the necessary qualifications to properly complete a uniform mitigation verification form pursuant to Section 627.711(2), Florida Statutes.

Individuals other than licensed contractors licensed under Section 489.111, Florida Statutes, or professional engineer licensed under Section 471.015, Florida Statues, must inspect the structures personally and not through employees or other persons. Licensees under s.471.015 or s.489.111 may authorize a direct employee who possesses the requisite skill, knowledge, and experience to conduct a mitigation verification inspection.

_____ am a qualified inspector and I personally performed the inspection or (licensed Ι, _ John Felten contractors and professional engineers only) I had my employee (Joshua Pierson) perform the inspection and I agree to be responsible for his/her work.

Oualified Inspector Signature:

Date: 05-20-2024

An individual or entity who knowingly or through gross negligence provides a false or fraudulent mitigation verification form is subject to investigation by the Florida Division of Insurance Fraud and may be subject to administrative action by the appropriate licensing agency or to criminal prosecution. (Section 627.711(4)-(7), Florida Statutes) The Qualified Inspector who certifies this form shall be directly liable for the misconduct of employees as if the authorized mitigation inspector personally performed the inspection.

Homeowner to complete: I certify that the named Qualified Inspector or his or her employee did perform an inspection of the residence identified on this form and that proof of identification was provided to me or my Authorized Representative.

Signature:

Date:

An individual or entity who knowingly provides or utters a false or fraudulent mitigation verification form with the intent to obtain or receive a discount on an insurance premium to which the individual or entity is not entitled commits a misdemeanor of the first degree. (Section 627.711(7), Florida Statutes)

The definitions on this form are for inspection purposes only and cannot be used to certify any product or construction feature as offering protection from hurricanes.

Inspectors Initials Property Address 1012 Pearce Dr, Building C, Units 101-303, Clearwater



RESERVE STUDIES | INSURANCE APPRAISALS | WIND MITIGATION

Windstorm Mitigation Report (OIR-B1-1802)

Seville Condominium #4, Inc.

1012 Pearce Dr, Elevator Building

Clearwater, FL 33764

Prepared Exclusively for Seville Condominium #4, Inc.

As of 05-20-2024 | FPAT File# MUD2422405

Felten Property Assessment Team

866.568.7853 | www.fpat.com



RECAPITULATION OF MITIGATION FEATURES For 1012 Pearce Dr, Elevator Building

1.	Building Code: Comments:	Unknown or does not meet the requirements of Answer A or B The year of construction was verified as 1971 per Pinellas County Property Appraiser.
2.	Roof Covering: Comments:	FBC Equivalent The roof covering was replaced in 2003. The roof permit was confirmed and the permit number is BCP2003-06103. This roof was verified as meeting the building code requirements outlined on the mitigation affidavit. In 2023 a silicone roof coating was applied to the roof to extend the life of the existing roof.
3.	Roof Deck Attachment: Comments:	Other Inspection verified a roof deck composed of lightweight concrete poured in metal pans supported by metal bar joists.
4.		Structural
	Attachment: Comments:	Inspection verified a roof-wall connection composed of steel bar joists structurally connected to the wall/support system.
5.	Roof Geometry: Comments:	Flat Roof Inspection verified a flat roof shape.
6.	SWR: Comments:	No At the time of inspection, no SWR was verified.
7.	Opening Protection: Comments:	None or Some Glazed Openings Inspection verified some opening protection. Not all glazed openings were protected with impact resistant coverings.

SUPPORTING DOCUMENTION OF WINDSTORM MITIGATION FEATURES LOCATED AT: 1012 Pearce Dr, Elevator Building

FPAT File #MUD2422405

Address Verification



Exterior Elevation

Exterior Elevation

SUPPORTING DOCUMENTION OF WINDSTORM MITIGATION FEATURES LOCATED AT: 1012 Pearce Dr, Elevator Building

Exterior Elevation



Record BCP2003-06103: Building - Over the Counter Permit **Record Status: Completed** Record Info 🔻 Payments 👻 To see plan review comments: 1. Select Record Info tab above 2. Record Details 3. Select the Print/View Conditions button at the bottom. To schedule/view inspection 1. Select Record Info tab above 2. Select Inspections Comments will NOT be available until all plans examiners have completed their revi


Address Info:

1012 PEARCE DR CLEARWATER FL

Record Details

To print a summary of this page click "REPORTS" in the top right hand corner of the page. Then click "CASE SUMMARY" Licensed Professional Info: Project Name SEVILLE CONDO BUILDING 4 REMOVE EXISTING TILE AND UNDERLAYMENT AND INSTALL NEW DRY IN TILE UNDERLAYMENT AND MONIER. SILVERS, MICHAEL J., L/H SILVERS SYSTEMS INC

LIFE TILE

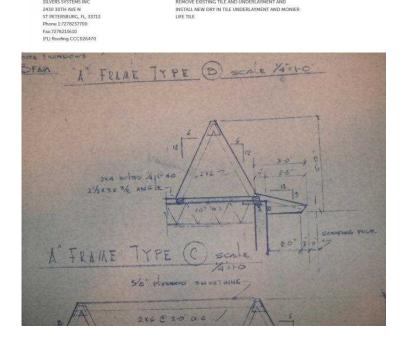

Roof Permit Information

Roof Construction

SUPPORTING DOCUMENTION OF WINDSTORM MITIGATION FEATURES LOCATED AT: 1012 Pearce Dr, Elevator Building

Roof Construction



Uniform Mitigation Verification Inspection Form

Maintain a copy of this form and any documentation provided with the insurance policy

Inspection Date: 05-20-2024

1						
Owner Information						
Owner Name: Seville Condominium #4, Ir	Contact Person: Robert Kelly					
Address: 1012 Pearce Dr, Elevator Buildir	Home Phone:					
City: Clearwater Zip: 33764		Work Phone: (727) 726-8000				
County: Pinellas		Cell Phone:				
Insurance Company:	Policy #:					
Year of Home: 1971	# of Stories: 3	Email: rkelly@ameritechmail.com				

NOTE: Any documentation used in validating the compliance or existence of each construction or mitigation attribute must accompany this form. At least one photograph must accompany this form to validate each attribute marked in questions 3 though 7. The insurer may ask additional questions regarding the mitigated feature(s) verified on this form.

- 1. <u>Building Code</u>: Was the structure built in compliance with the Florida Building Code (FBC 2001 or later) OR for homes located in the HVHZ (Miami-Dade or Broward counties), South Florida Building Code (SFBC-94)?
- [] A. Built in compliance with the FBC: Year Built . For homes built in 2002/2003 provide a permit application with a date after 3/1/2002: Building Permit Application Date (MM/DD/YYYY)
- [] B. For the HVHZ Only: Built in compliance with the SFBC-94: Year Built _____. For homes built in 1994, 1995, and 1996 provide a permit application with a date after 9/1/1994: Building Permit Application Date (MM/DD/YYYY) ___/ __/
- [X] C. Unknown or does not meet the requirements of Answer "A" or "B"
- <u>Roof Covering:</u> Select all roof covering types in use. Provide the permit application date OR FBC/MDC Product Approval number OR Year of Original Installation/Replacement OR indicate that no information was available to verify compliance for each roof covering identified.

2.1 Roof Covering Type:	Permit Application Date	FBC or MDC Product Approval #	Year of Original Installation or Replacement	No Information Provided for Compliance
[] 1. Asphalt/Fiberglass Shingle				[]
[X] 2. Concrete/Clay Tile	06-04-2003		2003	[]
[] 3. Metal				[]
[X] 4. Built Up	06-04-2003		2003	[]
[] 5. Membrane				[]
[X] 6. Other Silicone Coating			2023	[]
 [X] 2. Concrete/Clay Tile [] 3. Metal [X] 4. Built Up [] 5. Membrane 			2003	

- [X] A. All roof coverings listed above meet the FBC with a FBC or Miami-Dade Product Approval listing current at time of installation OR have a roofing permit application date on or after 3/1/02 OR the roof is original and built in 2004 or later.
- [] B. All roof coverings have a Miami-Dade Product Approval listing current at time of installation OR (for the HVHZ only) a roofing permit application after 9/1/1994 and before 3/1/2002 OR the roof is original and built in 1997 or later.
- [] C. One or more roof coverings do not meet the requirements of Answer "A" or "B".
- D. No roof coverings meet the requirements of Answer "A" or "B".

3. **<u>Roof Deck Attachment</u>**: What is the <u>weakest</u> form of roof deck attachment?

- [] A. Plywood/Oriented strand board (OSB) roof sheathing attached to the roof truss/rafter (spaced a maximum of 24" inches o.c.) by staples or 6d nails spaced at 6" along the edge and 12" in the field. -OR- Batten decking supporting wood shakes or wood shingles.
 -OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that has an equivalent mean uplift less than that required for Options B or C below.
- [] B. Plywood/OSB roof sheathing with a minimum thickness of 7/16"inch attached to the roof truss/rafter (spaced a maximum of 24"inches o.c.) by 8d common nails spaced a maximum of 12" inches in the field.-OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent or greater resistance than 8d nails spaced a maximum of 12 inches in the field or has a mean uplift resistance of at least 103 psf.
- [] C. Plywood/OSB roof sheathing with a minimum thickness of 7/16"inch attached to the roof truss/rafter (spaced a maximum of 24"inches o.c.) by 8d common nails spaced a maximum of 6" inches in the field. -OR- Dimensional lumber/Tongue & Groove decking with a minimum of 2 nails per board (or 1 nail per board if each board is equal to or less than 6 inches in width). -OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent

Inspectors Initials Property Address 1012 Pearce Dr, Elevator Building, Clearwater

or greater resistance than 8d common nails spaced a maximum of 6 inches in the field or has a mean uplift resistance of at least 182 psf.

- [] D. Reinforced Concrete Roof Deck.
- [X] E. Other: Steel bar joist w/ lightweight concrete
- [] F. Unknown or unidentified.
- [] G. No attic access.
- 4. **<u>Roof to Wall Attachment</u>**: What is the <u>WEAKEST</u> roof to wall connection? (Do not include attachment of hip/valley jacks within 5 feet of the inside or outside corner of the roof in determination of WEAKEST type)
- [] A. Toe Nails

[] Truss/rafter anchored to top plate of wall using nails driven at an angle through the truss/rafter and attached to the top plate of the wall, or

[] Metal connectors that do not meet the minimal conditions or requirements of B, C, or D

Minimal conditions to qualify for categories B, C, or D. All visible metal connectors are:

[]Secured to truss/rafter with a minimum of three (3) nails, and

[]Attached to the wall top plate of the wall framing, or embedded in the bond beam, with less than a ¹/₂" gap from the blocking or truss/rafter **and** blocked no more than 1.5" of the truss/rafter, **and** free of visible severe corrosion.

[] B. Clips

[] Metal connectors that do not wrap over the top of the truss/rafter, or

[] Metal connectors with a minimum of 1 strap that wraps over the top of the truss/rafter and does not meet the nail position requirements of C or D, but is secured with a minimum of 3 nails.

[] C. Single Wraps

Metal connectors consisting of a single strap that wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side and a minimum of 1 nail on the opposing side.

[] D. Double Wraps

[] Metal Connectors consisting of 2 separate straps that are attached to the wall frame, or embedded in the bond beam, on either side of the truss/rafter where each strap wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side, and a minimum of 1 nail on the opposing side, or

[] Metal connectors consisting of a single strap that wraps over the top of the truss/rafter, is secured to the wall on both sides, and is secured to the top plate with a minimum of three nails on each side.

[X] E. Structural Anchor bolts structurally connected or reinforced concrete roof.

[] F. Other:

- [] G. Unknown or unidentified
- [] H. No attic access
- 5. <u>Roof Geometry</u>: What is the roof shape? (Do not consider roofs of porches or carports that are attached only to the fascia or wall of the host structure over unenclosed space in the determination of roof perimeter or roof area for roof geometry classification).
- [] A. Hip Roof Hip roof with no other roof shapes greater than 10% of the total roof system perimeter.
- Total length of non-hip features: ; Total roof system perimeter:
- [X] B. Flat Roof Roof on a building with 5 or more units where at least 90% of the main roof area has a roof slope of less than 2:12. Roof area with slope less than 2:12: sq ft; Total roof area: sq ft
- [] C. Other Roof Any roof that does not qualify as either (A) or (B) above.

6. Secondary Water Resistance (SWR): (standard underlayments or hot-mopped felts do not qualify as an SWR)

- [] A. SWR (also called Sealed Roof Deck) Self-adhering polymer modified-bitumen roofing underlayment applied directly to the sheathing or foam adhesive SWR barrier (not foamed-on insulation) applied as a supplemental means to protect the dwelling from water intrusion in the event of roof covering loss.
- [X] B. No SWR.
- [] C. Unknown or undetermined.

Inspectors Initials Froperty Address 1012 Pearce Dr, Elevator Building, Clearwater

*This verification form is valid for up to five (5) years provided no material changes have been made to the structure or inaccuracies found on the form.

OIR-B1-1802 (Rev. 01/12) Adopted by Rule 69O-170.0155

Opening Protection: What is the <u>weakest</u> form of wind borne debris protection installed on the structure? First, use the table to determine the weakest form of protection for each category of opening. Second, (a) check one answer below (A, B, C, N, or X) based upon the lowest protection level for ALL Glazed openings and (b) check the protection level for all Non-Glazed openings (.1, .2, or .3) as applicable.

Opening Protection Level Chart		Glazed Openings				Non-Glazed Openings	
openi form	an "X" in each row to identify all forms of protection in use for each ng type. Check only one answer below (A thru X), based on the weakest of protection (lowest row) for any of the Glazed openings and indicate eakest form of protection (lowest row) for Non-Glazed openings.), based on the weakest openings and indicate Decrements Skylights Decrements Skylights		Glass Block	Entry Doors	Garage Doors	
N/A	Not Applicable- there are no openings of this type on the structure		Х	Х	Х		Х
Α	Verified cyclic pressure & large missile (9-lb for windows doors/4.5 lb for skylights)						
В	Verified cyclic pressure & large missile (4-8 lb for windows doors/2 lb for skylights)						
с	Verified plywood/OSB meeting Table 1609.1.2 of the FBC 2007						
D	Verified Non-Glazed Entry or Garage doors indicating compliance with ASTM E 330, ANSI/DASMA 108, or PA/TAS 202 for wind pressure resistance						
	Opening Protection products that appear to be A or B but are not verified						
N	Other protective coverings that cannot be identified as A, B, or C						
х	No Windborne Debris Protection	Х				Х	

- [] <u>A. Exterior Openings Cyclic Pressure and 9-lb Large Missile (4.5 lb for skylights only)</u> All Glazed openings are protected at a minimum, with impact resistant coverings or products listed as wind borne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level A in the table above).
 - Miami-Dade County PA 201, 202, and 203
 - Florida Building Code Testing Application Standard (TAS) 201, 202, and 203
 - American Society for Testing and Materials (ASTM) E 1886 and ASTM E 1996
 - Southern Standards Technical Document (SSTD) 12
 - For Skylights Only: ASTM E 1886 and ASTM E 1996
 - For Garage Doors Only: ANSI/DASMA 115
 - [] A.1 All Non-Glazed openings classified as A in the table above, or no Non-Glazed openings exist
 - A.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level B, C, N, or X in the table above
 - [] A.3 One or More Non-Glazed Openings is classified as Level B, C, N, or X in the table above
- [] <u>B. Exterior Opening Protection- Cyclic Pressure and 4 to 8-lb Large Missile (2-4.5 lb for skylights only)</u> All Glazed openings are protected, at a minimum, with impact resistant coverings or products listed as windborne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level B in the table above):
 - ASTM E 1886 <u>and</u> ASTM E 1996 (Large Missile 4.5 lb.)
 - SSTD 12 (Large Missile 4 lb. to 8 lb.)
 - For Skylights Only: ASTM E 1886 and ASTM E 1996 (Large Missile 2 to 4.5 lb.)
 - 🗌 B.1 All Non-Glazed openings classified as A or B in the table above, or no Non-Glazed openings exist
 - B.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level C, N, or X in the table above
 - \square B.3 One or More Non-Glazed openings is classified as Level C, N, or X in the table above
- [] <u>C. Exterior Opening Protection- Wood Structural Panels meeting FBC 2007</u> All Glazed openings are covered with plywood/OSB meeting the requirements of Table 1609.1.2 of the FBC 2007 (Level C in the table above).
 - 🗌 C.1 All Non-Glazed openings classified as A, B, or C in the table above, or no Non-Glazed openings exist
 - C.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level N or X in the table above
 - \Box C.3 One or More Non-Glazed openings is classified as Level N or X in the table above

Inspectors Initials *Property* Address <u>1012 Pearce Dr. Elevator Building</u>, Clearwater

[] N. Exterior Opening Protection (unverified shutter systems with no documentation) All Glazed openings are protected with

- protective coverings not meeting the requirements of Answer "A", "B", or C" or systems that appear to meet Answer "A" or "B" with no documentation of compliance (Level N in the table above).
- N.1 All Non-Glazed openings classified as Level A, B, C, or N in the table above, or no Non-Glazed openings exist \square
- N.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level X in the table above
- N.3 One or More Non-Glazed openings is classified as Level X in the table above

[X] X. None or Some Glazed Openings One or more Glazed openings classified and Level X in the table above.

MITIGATION INSPECTIONS MUST BE CERTIFIED BY A OUALIFIED INSPECTOR. Section 627.711(2), Florida Statutes, provides a listing of individuals who may sign this form.

		-	° •
Qualified Inspector Name: John Felten	License Type: CBC		License or Certificate #: CBC1255984
Inspection Company: Felten Property Assessment Team	-	Phone:	866-568-7853

Qualified Inspector – I hold an active license as a: (check one)

- Home inspector licensed under Section 468.8314, Florida Statutes who has completed the statutory number of hours of hurricane mitigation training approved by the Construction Industry Licensing Board and completion of a proficiency exam.
- Building code inspector certified under Section 468.607, Florida Statutes.
- \boxtimes General, building or residential contractor licensed under Section 489.111, Florida Statutes.
- Professional engineer licensed under Section 471.015, Florida Statutes.
- Professional architect licensed under Section 481.213, Florida Statutes.
- Any other individual or entity recognized by the insurer as possessing the necessary qualifications to properly complete a uniform mitigation verification form pursuant to Section 627.711(2), Florida Statutes.

Individuals other than licensed contractors licensed under Section 489.111, Florida Statutes, or professional engineer licensed under Section 471.015, Florida Statues, must inspect the structures personally and not through employees or other persons. Licensees under s.471.015 or s.489.111 may authorize a direct employee who possesses the requisite skill, knowledge, and experience to conduct a mitigation verification inspection.

____ am a qualified inspector and I personally performed the inspection or (*licensed* Ι, _ John Felten contractors and professional engineers only) I had my employee (Joshua Pierson) perform the inspection and I agree to be responsible for his/her work.

Oualified Inspector Signature:

Date: 05-20-2024

An individual or entity who knowingly or through gross negligence provides a false or fraudulent mitigation verification form is subject to investigation by the Florida Division of Insurance Fraud and may be subject to administrative action by the appropriate licensing agency or to criminal prosecution. (Section 627.711(4)-(7), Florida Statutes) The Qualified Inspector who certifies this form shall be directly liable for the misconduct of employees as if the authorized mitigation inspector personally performed the inspection.

Homeowner to complete: I certify that the named Qualified Inspector or his or her employee did perform an inspection of the residence identified on this form and that proof of identification was provided to me or my Authorized Representative.

Signature:

Date:

An individual or entity who knowingly provides or utters a false or fraudulent mitigation verification form with the intent to obtain or receive a discount on an insurance premium to which the individual or entity is not entitled commits a misdemeanor of the first degree. (Section 627.711(7), Florida Statutes)

The definitions on this form are for inspection purposes only and cannot be used to certify any product or construction feature as offering protection from hurricanes.

Inspectors Initials Froperty Address 1012 Pearce Dr, Elevator Building, Clearwater